

IMAGES FROM WELLINGTON SEWER CAMERA LOGS

136.9	Root	Yes	/	Moderate	HAD TO STOP HERE DO TO ROOTS AND BEYOND ROOTS IS WERE THE STUB IS BUT HAS BEEN BROKEN AND NOW THE DIRT IS EXPOSED

CANNOT CUT

211.9	15.2	Sag	No	/	Minor	
286.6		Root-in-Joint	No	/	Severe	THIS IS TOP END OF ROOT MASS
286.6		STOP	No	/		



146.8	STOP	Yes	/		
-------	------	-----	---	--	--

Distance	Length	Code	Reversed	Clock Pos.	Severity	Comment

148.2	Root-in-Joint	Yes	/	Severe	
-------	---------------	-----	---	--------	--




149.2	Root-in-Joint	Yes	/	Severe	HAD TO STOP DUE TO ROOTS. NEEDS TO BE CUT OUT. WE WILL TRY TO TV FROM TOP END AND COME DOWN TO THIS POINT
-------	---------------	-----	---	--------	---

149.2	STOP	Yes	/		
-------	------	-----	---	--	--

9.4	Lateral	No	10 /			
9.4	Lateral Connection Problem	No	/	Lateral Blocked	Severe	BROKEN CAP WEDGED IN SERVICE



Distance	Length	Code	Reversed	Clock Pos.	Severity	Comment
8.0	FLOW	Surface Damage	Yes	/	Moderate	
22.5	Surface Damage	Yes	/	Moderate	HAD TO STOP HERE DUE TO BUILD UP, AND ALREADY TRY TO TV DOWN FROM TOP. TOTAL SECTION LENGTH IS 207	

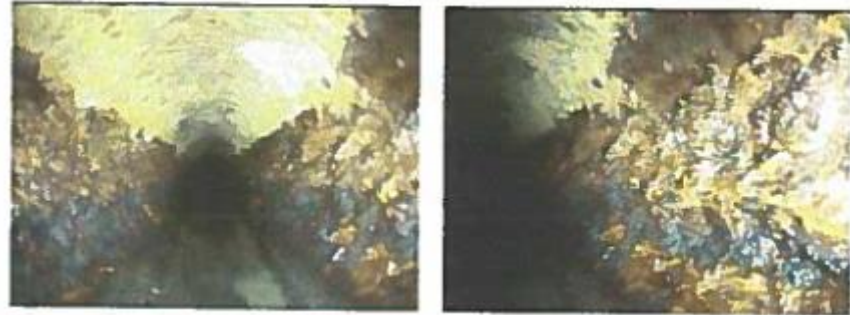

Distance	Length	Code	Reversed	Clock Pos.	Severity	Comment
22.5	STOP	Yes	/			

Distance	Length	Code	Reversed	Clock Pos.	Severity	Comment
2.0	START WITH FLOW	No	/			
2.0	Hole	No	/	Forming Cavity	Severe	



Distance	Length	Code	Reversed	Clock Pos.	Severity	Comment
5.8	393.2	Surface Damage	No	/	Moderate	Severe
					Material Damage - Chemical	

Observations

Distance	Length	Code	Reversed	Clock Pos.	Severity	Comment
25.9	Hole	No	/	Problem Forming Cavity	Severe	
36.2	Cavity	No	/	Severe		
36.2	Hole	No	/	Forming Cavity	Severe	
51.0	Hole	No	/	Forming Cavity	Severe	



Distance	Length	Code	Reversed	Clock Pos.	Severity	Comment
167.0	Hole	No	/	Severe		

